Thank you for purchasing this Dynojet kit. This kit has been developed for a motorcycle which is set to the parameters listed at the right in the "Stage" description. If your motorcycle does not meet any of these parameters please check with Dynojet before installation. For technical assistance contact your Dynojet distributor or call Dynojet U.S.A. (800)-992-4993

2191 Mendenhall Dr. Suite 105 North Las Vegas, NV 89031 TEL: 702-399-1423 FAX: 702-399-1431 8am-5pm Pacific Time Monday through Friday

Website Address http://www.dynojet.com

The manufacturer and seller make no warranties express or implied which extend beyond the description of the goods contained herein. Any description of this product is for the purpose of identifying it and shall not be deemed to create an express warranty.




E3120.001

European Models Only

1995-98 Suzuki GSF600 Bandit & Bandit S

Stage 1

For mildly tuned machines using the stock airbox, with stock or K&N filter. May also be used with a good aftermarket exhaust system K&N filter #SU-7593

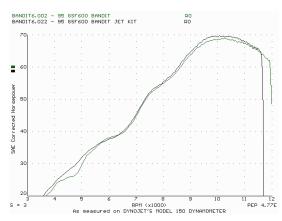

This graph shows a typical gain with a Dynojet jet kit.

WARNING

NO SMOKING! NO OPEN FLAME! WHILE INSTALLING YOUR DYNOJET KIT

Parts List		
4	Main Jets	DJ100
4	Main Jets	DJ104
4	Fuel Needles	DNO206
8	Adjusting Washers	DW0001
4	E-clips	DE0001
1	Slide Drill	DD #37

STAGE ONE INSTRUCTIONS

DY())0030 E3120.001

- 1. Remove vacuum slides from carbs. Remove stock needles and spacers, noting order of assembly (Fig. A). Using the (DD #37) drill bit provided, enlarge the slide lift hole (Fig. A). **Do not drill the needle hole.**
- 2. Install the Dynojet main jets provided. If you are running the stock exhaust install the DJ100 main jets. If you are running an aftermarket exhaust or slip-on with a high flowing baffle, use the DJ104 main jets. Be sure that the jet you are changing is the main jet.
- 3. Install Dynojet needles on groove #4. Use all stock spacers (Fig. A). Install the small Dynojet washers above the e-clip (2 per needle). After installing the slides in the carbs be sure to check slide movement manually.
- 4. Locate the fuel mixture screw (Fig. B). Carefully turn mixture screws clockwise until lightly seated, then back out 2 1/4 turns.

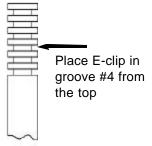


Fig. A

